



The 8300 Series is also available in a **Complete One Box Solution** 

Series The fire-rated, concealed solution for cylindrical locksets

RoHS compliant Patents: 5,934,720;

8,465,067

Metal

Wood

**Electrical** 

.24 Amps @

12VDC/VAC

.12 Amps @

24VDC/VAC

duty only

PoE friendly

DC continuous duty/

AC intermittent

8,146,966; 8,157,302;

**Frame Application** 

#### **Specifications**

- UL 10C fire-rated, 3 hour (fail secure only)
- CAN4-S104 (ULC-S104) fire door conformant
- NFPA 80-07 compliant
- UL 1034, burglaryresistant listed and suitable for outdoor use
- UL 294 (6th Edition) listed
- ANSI/BHMA A156.31, Grade 1
- NFPA-252 fire door conformant
- ASTM-E152 fire
   door conformant

# 8300 Models

#### 8300

Universal electric strike Faceplate options ordered separately, see page 40

#### 8300C

Complete electric strike Includes the 801 and 801A faceplates in the box Model 8300C includes a 801 and a 801A faceplate in the box


The 8300 series is a fire rated, compact, high


Shown with 801 Option

performance electric strike featuring a unique concealed design for use with cylindrical locksets. No cutting on the frame is required. Simply remove the existing strike plate, adjust the vertical alignment feature to the latchbolt centerline, and install. Its strength is derived from a unique keeper pin locking design, enabling the 8300 to exceed the ratings of the frame, door and locking hardware. This unique electric strike is easy to install and complies with NFPA 80-07 guidelines for retrofit into fire-rated frames. The 8300 accommodates latchbolts up to 5/8" throw.



#### ASSA ABLOY, the global leader in door opening solutions

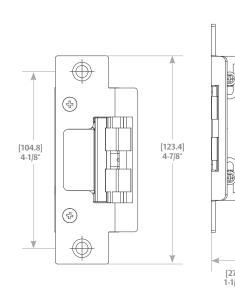

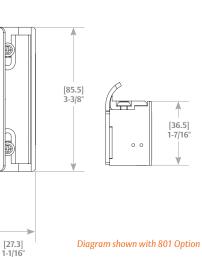

#### **Standard Features**

- Falls within the guidelines for retrofit into fire-rated frames
- No cutting on frame required
- Vertical adjustability to accommodate door sag and misalignment
- Tamper resistant
- Static strength 1,500 lbs.
- Dynamic strength 70 ft-lbs.
- Endurance 500,000 cycles
- Field selectable fail safe/fail secure
- Non-handed

- Accommodates 1/2" 5/8" cylindrical latchbolt (5/8" with 1/8" door gap)
- Strike body depth 1-1/16"
- Plug-in connector
- Five-year limited warranty

## **Optional Features**

• LBM » Latchbolt monitor

## Accessories

2001M » Plug-in bridge rectifier
2004M » ElectroLynx<sup>®</sup> adapter
2005M3 » SMART Pac<sup>®</sup> III
2006M » Plug-in buzzer

## **Finishes**

- 630 » Satin stainless steel
- 605 » Bright brass
- 606 » Satin brass
- 612 » Satin bronze
- 613 » Bronze toned
- 629 » Bright stainless steel
- BLK » Black
- \*Complete Pacs are only available in the 630 finish

CYLINDRICAL LOCKSETS FIELD SELECTABLE (12 OR 24VDC)

GRADE 1

FIELD SELECTABLE (FAIL SECURE / FAIL SAFE)

> OUTDOOR RATED

FIRE RATED

LISTER


hes


ASSA ABLOY


# 8000/8300 Series Faceplate Options



GENERAL NFORMATION

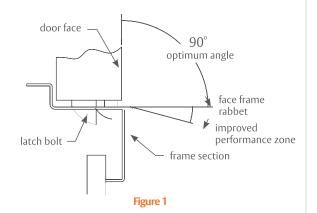

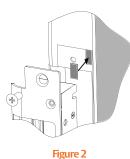



# Reduce your install time by evaluating your opening

The 8000/8300 can be adjusted to compensate for frame and door irregularities. Sometimes, adjusting the frame and door back to industry standards is just not an option. Here are some tips to quickly compensate for frame twist and determine the condition of the latch bolt.

#### **Measure Frame Twist**

One way to measure frame twist is to place a carpenter square on the stop and the face of the door. If the angle is less than 90 degrees, the 45 degree ramp angle of the 8000/8300 is steepened and may need to be corrected as shown at left (Figure 1).

We recommend you check the condition of the latch bolt prior to installing the 8000/8300. Poorly constructed, worn out or damaged latch bolts may not slide along a ramp at any angle. To check the condition of your latch bolt, we recommend applying a slight force to the tip of the latch bolt (about 45 degrees to the door face). Make sure the latch bolt can be pushed up into the door.

## **Compensate for Frame Twist**

When a frame is twisted, the relationship between the face of a closed door and of the inside face of the frame (i.e., Rabbet) may not meet the 90 degree industry standard. Untrue frames and doors impact latch bolt wear and the force required to exit, so we recommend you ensure that the angle is between 90–95 degrees.

If manipulating the frame is not possible, we recommend placing several shims under the top and bottom (stop side) of the faceplate (*Figure 2*). This effectively increases the 8000/8300 ramp angle and compensates for frame twist. You can also compensate for frame twist by placing shims under the top and bottom (bevel side) of the latchbolt (*Figure 3*).